

# HOME REPORT

**BANKGATE COTTAGE  
2 BALMUIR  
DUNDEE  
DD3 0PA**



**DM HALL**  
CHARTERED SURVEYORS



# ENERGY PERFORMANCE CERTIFICATE



**DM HALL**  
CHARTERED SURVEYORS



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

2 Bankgate Cottages, Strathmartine, Dundee, DD3 0PA

**Dwelling type:** Semi-detached house  
**Date of assessment:** 18 April 2022  
**Date of certificate:** 19 April 2022  
**Total floor area:** 155 m<sup>2</sup>  
**Primary Energy Indicator:** 221 kWh/m<sup>2</sup>/year

**Reference number:** 9880-1059-2234-7602-7220  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,215	See your recommendations report for more information
Over 3 years you could save*	£846	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs



Not energy efficient - higher running costs

Current	Potential
60	89

## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (60)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO<sub>2</sub> emissions



Not environmentally friendly - higher CO<sub>2</sub> emissions

Current	Potential
52	80

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (52)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£258.00
2 Floor insulation (suspended floor)	£800 - £1,200	£357.00
3 Low energy lighting	£35	£99.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Timber frame, as built, insulated (assumed)	★★★★★	★★★★★
Roof	Pitched, 100 mm loft insulation	★★★★☆☆	★★★★☆☆
	Pitched, 200 mm loft insulation	★★★★☆☆	★★★★☆☆
	Roof room(s), insulated	★★★★☆☆	★★★★☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Suspended, insulated (assumed)	—	—
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	Boiler and radiators, oil	★★★★☆☆	★★★★☆☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆☆	★★★★☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★★★☆☆	★★★★☆☆
Lighting	Low energy lighting in 63% of fixed outlets	★★★★☆☆	★★★★☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 56 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 8.7 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.













## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,372 over 3 years	£2,799 over 3 years	
Hot water	£417 over 3 years	£261 over 3 years	
Lighting	£426 over 3 years	£309 over 3 years	
<b>Totals</b>	<b>£4,215</b>	<b>£3,369</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£500 - £1,500	£86		
2 Floor insulation (suspended floor)	£800 - £1,200	£119		
3 Low energy lighting for all fixed outlets	£35	£33		
4 Solar water heating	£4,000 - £6,000	£44		
5 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£315		
6 Wind turbine	£15,000 - £25,000	£695		

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 6 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).



## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	19,805	(428)	(1,584)	N/A
Water heating (kWh per year)	2,995			

## Addendum

### About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Ewen Sparks
Assessor membership number:	EES/012600
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	13 Wemyssfield Kirkcaldy KY1 1XN
Phone number:	0131 477 6000
Email address:	<a href="mailto:dmhall@dmhall.co.uk">dmhall@dmhall.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## **Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



# SINGLE SURVEY



**DM HALL**  
CHARTERED SURVEYORS



# Single Survey

survey report on:

Property address	2 BANKGATE COTTAGES STRATHMARTINE DUNDEE ANGUS DD3 0PA
Customer	Elizabeth Ann Crozier
Customer address	
Prepared by	DM Hall LLP
Date of inspection	18th April 2022



## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

# Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;



- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	Semi detached bungalow.
<b>Accommodation</b>	GROUND FLOOR: Hall, Lounge, Bedroom, Kitchen, Shower Room with wc, Utility Room open with Inner Hallway and a further Two Bedrooms.  FIRST FLOOR: Landing, Bedroom and Bathroom with wc.
<b>Gross internal floor area (m<sup>2</sup>)</b>	149 sq metres or thereby.
<b>Neighbourhood and location</b>	The property occupies a rural position just out with the City of Dundee and just over three miles north of the city centre. Usual main facilities can be found nearby and there are views over countryside to Dundee from the rear.
<b>Age</b>	The property is originally understood to date from 1955.
<b>Weather</b>	Dry and sunny.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  There is a single chimney of roughcast brick construction finished with a clay pot.
<b>Roofing including roof space</b>	<b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b>  <b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b>  <b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b>

# Single Survey

	<p>Roof coverings are timber pitched and laid in concrete tiles with some plastic edging at verges and a metal valley gutter between different roof pitches to the front.</p> <p>There are various hatches to eaves voids off the attic bedroom and to roof spaces over the extension above the inner hall and off the stair. Eaves voids over the original part of the property are mostly floored for storage.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Rainwater fittings are of PVC.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>Original main walls are of cavity brick construction externally roughcast while walls around the extension are of cavity timber/concrete block and roughcast.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>Windows and doors, including several sets of garden doors are mainly of uPVC design with sealed unit double glazing while there are several timber framed Velux roof lights to the attic bedroom that are externally metal clad. There is timber fascia at the eaves around the edge of the roof.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>There are painted/stained external decorations to woodwork.</p>
<b>Conservatories / porches</b>	None.
<b>Communal areas</b>	None.
<b>Garages and permanent outbuildings</b>	There are several garden sheds although it is understood that these are to be removed prior to sale.

# Single Survey

<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>Garden grounds have been laid out around the property that are mostly finished in grass while there is a raised timber decking area built around the rear of the bungalow. Boundaries are a mixture of stone and timber and an area at the front is used for off-street car parking with access from the main road over an unmade shared access.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>Ceilings are mostly of plasterboard throughout the main accommodation while there is plastic panelling to the ceiling of the shower room. Some ceilings have textured plaster finishes.</p>
<b>Internal walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal walls are a mixture of brick plastered on the hard and plasterboard lined while there are laminate boarded walls around the shower room and tiled walls around the bathroom.</p>
<b>Floors including sub floors</b>	<p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p>Floor are of suspended timber within the original accommodation and of suspended chipboard within the extension and first floor rooms.</p>
<b>Internal joinery and kitchen fittings</b>	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>Internal doors are a mixture of timber panelled and moulded panel types with plain skirtings and facings around. There is a timber stair to first floor level with a handrail to one side. Kitchen and utility fittings comprise floor and wall mounted units.</p>
<b>Chimney breasts and fireplaces</b>	<p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>There is a cast iron and tiled fireplace with timber surround in the lounge.</p>
<b>Internal decorations</b>	<p><b>Visually inspected.</b></p> <p>There are mainly painted internal decorations and some varnished and tiled finishes.</p>

# Single Survey


Cellars	None.
Electricity	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply with meter boxed in at high level to the front of the hall by the entrance door.</p>
Gas	None.
Water, plumbing, bathroom fittings	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains water supply with plumbing of copper and PVC where seen. The mains water stopcock is understood to be boxed in behind the toilet in the shower room. There is a plastic cold water storage tank in the roof space over the front bedroom in the extension.</p> <p>There is a stainless steel sink unit, plumbing for a dishwasher and washing machine in the kitchen.</p> <p>Sanitary fittings comprise a white three piece shower suite at ground floor level that includes a shower cubicle lined in laminate boarding with glazed screen/door around. At first floor level there is a white bathroom suite that includes a feature bath on legs with a shower tap fitting.</p>
Heating and hot water	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is an oil fired central heating system with boiler located in the utility room. This serves radiators throughout and also provides hot water with insulated storage tank located in the roof space over the front extension. Hot water at this tank is supplemented by an electric immersion heater.</p> <p>There is a plastic oil storage tank located within the front garden.</p> <p>Additional hot water is provided by an electric shower unit at the ground floor shower.</p>

<b>Drainage</b>	<p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Drainage is understood to be to a septic tank located within the rear garden that is shared with the adjoining bungalow.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Several smoke detectors have been fitted.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p> <p>The existence or otherwise of a burglar alarm has not been commented on for security reasons.</p>
<b>Any additional limits to inspection</b>	<p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect. The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring and no access was available beneath sanitary or kitchen fittings. Cupboards were full of stored items.</p> <p>In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</p> <p>I was not able to inspect the sub floor area and concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>My physical inspection of the roof void area was restricted due to insulation material, stored items and lack of suitable crawl boards. As a result the roof void areas were only viewed from the access hatches.</p> <p>The circuits and services, including the central heating system, were not tested or checked and the mains water feed pipe and stopcock could not be inspected.</p> <p>The septic tank was not inspected or tested.</p> <p>I was not able to fully inspect all areas of boundary walls and fencing due to garden vegetation and sheds.</p> <p>I have not carried out an inspection for Japanese Knotweed and</p>



	<p>unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</p> <p>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.</p>
--	---

## Sectional Diagram showing elements of a typical house

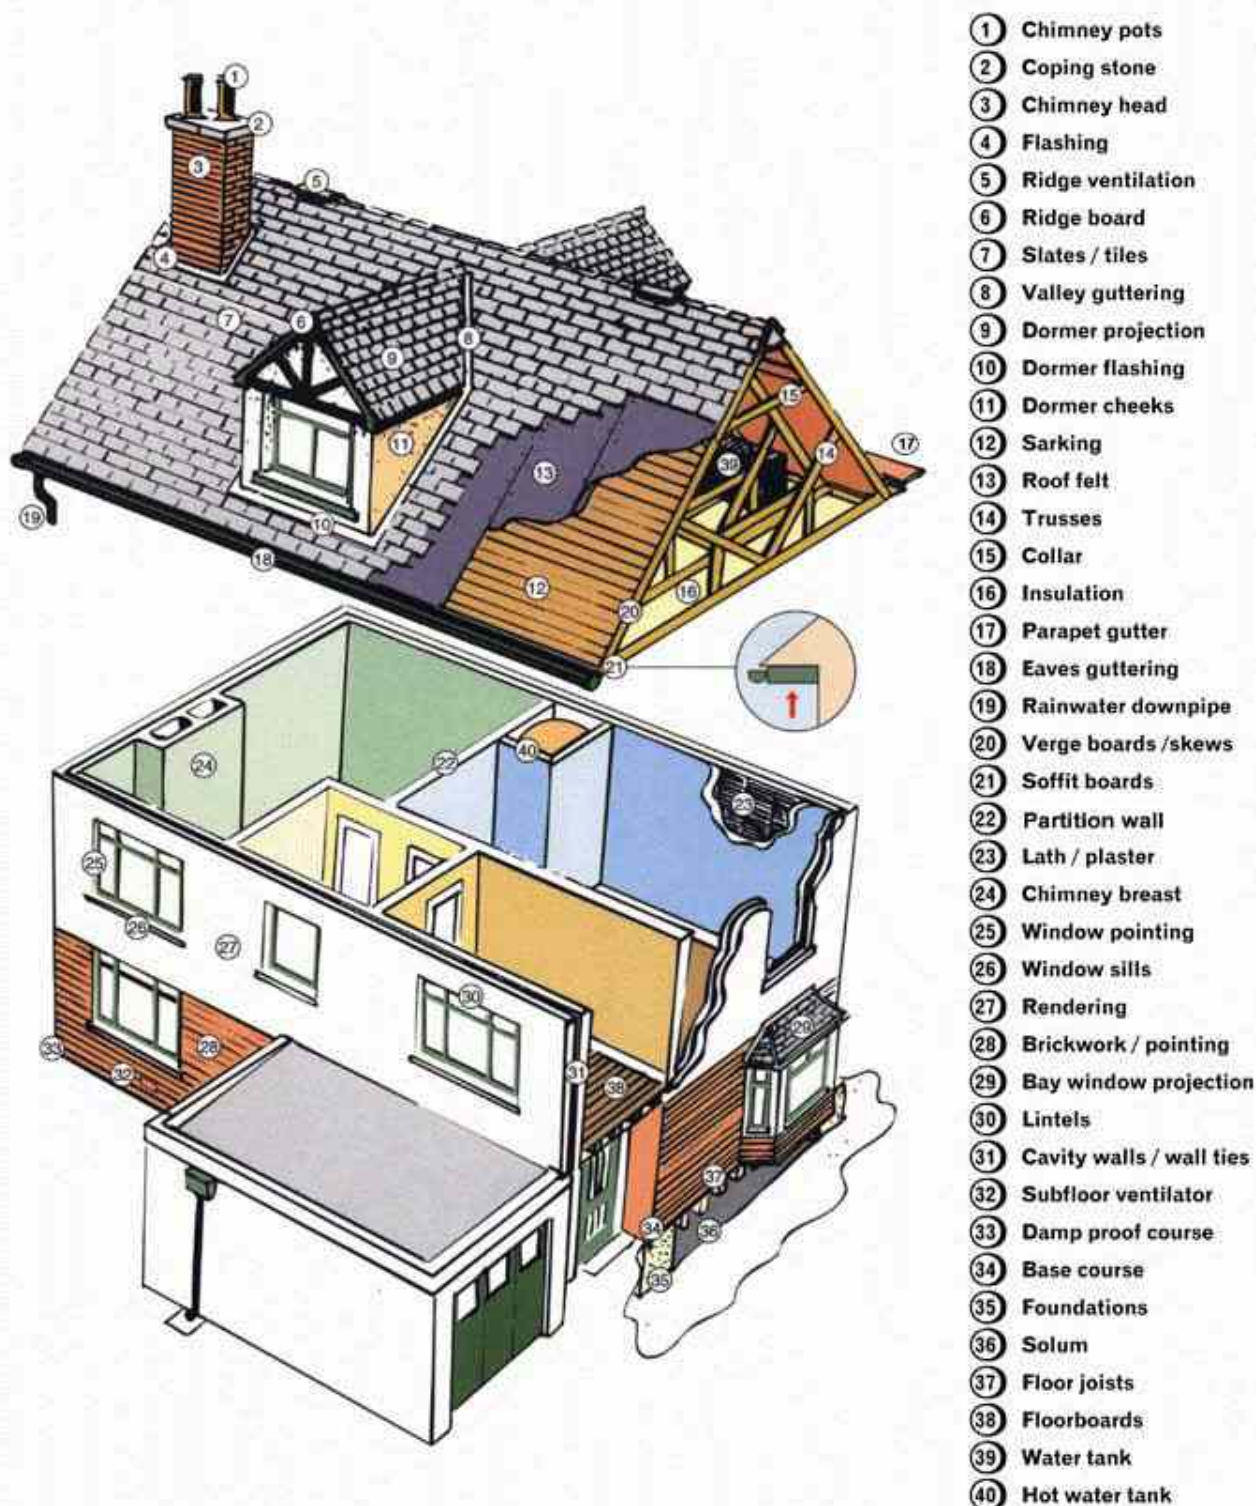

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

# Single Survey

## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.



### Structural movement

Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.



### Dampness, rot and infestation

Repair category	1
Notes	<p>No obvious evidence of significant dampness, rot or wood boring insect infestation.</p> <p>It is understood that treatments for some decay to flooring and the sealing of the solum beneath original flooring has recently been carried out by Wise Property Care to a guaranteed standard.</p> <p>Evidence of vermin was noted within the roof void areas although this is inevitable given the rural situation.</p>



### Chimney stacks

Repair category	2
Notes	There is spalling roughcast noted around the top of the chimney. A contractor will be able to advise on the necessary repairs.



### Roofing including roof space

Repair category	1
Notes	<p>No significant defects were noted at the time of inspection. Nevertheless, roofing contractors recommend that roof coverings are inspected regularly in order to ensure they remain watertight. There is some scattered moss growth to roof tiles.</p> <p>It is noted that not all areas of the roof are insulated and this is particularly</p>

# Single Survey

	noticeable at walls around the attic bedroom.
--	---



## Rainwater fittings

Repair category	1
Notes	One or two areas of slightly uneven guttering were noted but no evidence of obvious leakage was apparent.



## Main walls

Repair category	2
Notes	Some areas of cracked and bossed roughcast were noted around window/door openings and this is particularly noticeable to the rear. Areas of bossed roughcast were also noted around parts of the front extension and while generally this area was found to be intact future patching/re-roughcasting works may need to be envisaged. A competent local builder can examine with a view to having all necessary remedial repair work implemented.



## Windows, external doors and joinery

Repair category	1
Notes	<p>Windows were not all fully opened or tested and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of my inspection, no significant defects were noted.</p> <p>Garden doors at the kitchen appear to have dropped slightly on their hinges although not to a serious degree.</p> <p>A weather bar is missing at the base of the front door.</p> <p>One or two areas of loose mastic were noted around windows, resulting in gaps around the front frames</p> <p>Possible asbestos based materials were noted in the construction of the property at soffit boarding below the eaves of the roof over the original part of the bungalow and where supporting projecting roof tiles at the verge of the roof to the rear. If these materials remain intact and in good condition, the current informed opinion is that they will pose no significant hazard to health. See information on Asbestos in the Limitations of Inspection section above.</p>





## External decorations


Repair category	1
Notes	No significant defects evident.


# Single Survey


 Conservatories/porches	
Repair category	-
Notes	Not applicable.

 Communal areas	
Repair category	-
Notes	Not applicable.

 Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable - sheds are to be removed.

 Outside areas and boundaries	
Repair category	2
Notes	<p>Damaged and leaning fencing was noted to one side of the rear garden. It is understood that this is a neighbour's fence and is to be replaced soon.</p> <p>Elsewhere, fencing and stone walls do show signs of age and weathering. Not all boundaries could be checked due to outbuildings and vegetation. Garden grounds appear to have seen the minimum of maintenance in recent times.</p> <p>There is a coniferous tree within the site to the left side of the property and elsewhere there are some mature trees and hedges within neighbouring grounds some of which overhang this site. Mature trees/vegetation within and around the grounds of the property will require future ongoing professional maintenance by an experienced contractor.</p>

 Ceilings	
Repair category	1
Notes	No significant defects evident.

 Internal walls	
Repair category	1
Notes	No significant defects evident.

# Single Survey



## Floors including sub-floors

Repair category	1
Notes	<p>While my inspection of flooring was very limited, no significant defects were evident.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p>



## Internal joinery and kitchen fittings

Repair category	1
Notes	No significant defects evident, although it is noted that there is no seal around the edge of work surfaces in the kitchen.



## Chimney breasts and fireplaces

Repair category	2
Notes	<p>The fireplace was originally built with a back boiler that has now been disconnected although pipe work is still evident within the lounge and a damaged back boiler tank within the fireplace was noted. It is understood this does not affect the use of the fireplace although consideration to removal of what is left of redundant plumbing and making good of the fireplace opening may well be considered.</p>



## Internal decorations

Repair category	1
Notes	No significant defects evident.



## Cellars

Repair category	-
Notes	Not applicable.




## Electricity


Repair category	1
Notes	<p>Wiring does appear to have been upgraded in the course of past renovations. No tests have been undertaken of the system and a visual inspection did not reveal any obvious signs of any significant defects or deficiencies that might suggest there could be major issues with the system.</p> <p>It is recommended that all electrical installations be checked every five years or</p>


# Single Survey

	on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.
--	---

 Gas	
Repair category	-
Notes	Not applicable.

 Water, plumbing and bathroom fittings	
Repair category	1
Notes	<p>No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted.</p> <p>While there is an extractor fan in the bathroom, there is no extractor fan in the shower room.</p>

 Heating and hot water	
Repair category	1
Notes	<p>No tests have been undertaken of the heating or hot water systems, however within the limitations of our inspection, no significant defects were noted.</p> <p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>Boilers and central heating systems should be tested and serviced by an Oftec registered engineer on an annual basis to ensure their safe and efficient operation.</p>

 Drainage	
Repair category	2
Notes	The cover to the septic tank was noted to be damaged and may represent a safety hazard.



# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	1
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	2
Internal decorations	1
Cellars	-
Electricity	1
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	2

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.



# Single Survey

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground & first
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The property has been altered and extended. It is understood that the attic was converted and the ground floor extended around 2010 for which it is understood all necessary Local Authority consents have been obtained. Documentation in this regard should be checked.

Access off the main road appears to be via a shared entrance splay. Details of this along with the exact extent of the garden grounds pertaining to the property and ownership of boundaries are assumed to be clearly set out in the Title Deeds.

The schedule of work and associated guarantee for past specialist treatments to flooring undertaken recently should be obtained, checked and validated.

Drainage is to a shared septic tank located within the rear garden. It is assumed that the tank is registered with SEPA.

### Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £370,000 (THREE HUNDRED AND SEVENTY THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

### Valuation and market comments

Having considered matters, taking account of my general observations on site, I am of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £270,000 (TWO HUNDRED AND SEVENTY THOUSAND POUNDS).

The local market has been extremely buoyant since the easing of lockdown restrictions as a result of the Covid 19 Pandemic in 2020. This surge in demand has resulted in increases in house prices generally across all sectors of the market. Whilst the valuation opinion reflects these conditions, it is not possible to predict how the market will react in the coming months and an increased supply of available property may soften price levels generally.

<b>Signed</b>	Security Print Code [531837 = 5662 ] Electronically signed
<b>Report author</b>	Ewen S Sparks
<b>Company name</b>	DM Hall LLP
<b>Address</b>	Shed 26, Unit 34, City Quay, Camperdown Street, Dundee, DD1 3JA

# Single Survey

Date of report	22nd April 2022
----------------	-----------------

# Mortgage Valuation Report



## Property Address

Address 2 BANKGATE COTTAGES, STRATHMARTINE, DUNDEE, ANGUS, DD3 0PA  
Seller's Name Elizabeth Ann Crozier  
Date of Inspection 18th April 2022

## Property Details

Property Type ☐ House ☒ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette  
☐ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use  
☐ Other (specify in General Remarks)

Property Style ☐ Detached ☒ Semi detached ☐ Mid terrace ☐ End terrace  
☐ Back to back ☐ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? ☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided? ☐ Yes ☐ No  
No. of units in block

Approximate Year of Construction

## Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

## Garage / Parking / Outbuildings

☐ Single garage ☐ Double garage ☒ Parking space ☐ No garage / garage space / parking space  
Available on site? ☒ Yes ☐ No

Permanent outbuildings:

None.

# Mortgage Valuation Report

## Construction

Walls ☒ Brick ☐ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)  
Roof ☒ Tile ☐ Slate ☐ Asphalt ☐ Felt ☐ Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement? ☐ Yes ☒ No

If Yes, is this recent or progressive? ☐ Yes ☐ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☐ Mains ☒ Private ☐ None Water ☒ Mains ☐ Private ☐ None  
Electricity ☒ Mains ☐ Private ☐ None Gas ☐ Mains ☐ Private ☒ None  
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Oil fired boiler to radiators.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☒ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections  
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)

## Location

☐ Residential suburb ☐ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial  
☐ Commuter village ☐ Remote village ☒ Isolated rural property ☐ Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered? ☒ Yes ☐ No

If Yes provide details in General Remarks.

## Roads

☐ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☒ Adopted ☐ Unadopted

# Mortgage Valuation Report

## General Remarks

The property occupies a rural position just out with the City of Dundee and just over three miles north of the city centre. Usual main facilities can be found nearby and there are views over countryside to Dundee from the rear.

The property appears to have been adequately maintained having regard to its age and character and no evidence of serious structural defect was noted. While there are now a number of items requiring attention, these are mainly of a relatively minor nature and should mostly be capable of remedy in the course of maintenance and redecoration.

The property has been altered and extended. It is understood that the attic was converted and the ground floor extended around 2010 for which it is understood all necessary Local Authority consents have been obtained. Documentation in this regard should be checked.

Access off the main road appears to be via a shared entrance splay. Details of this along with the exact extent of the garden grounds pertaining to the property and ownership of boundaries are assumed to be clearly set out in the Title Deeds.

The schedule of work and associated guarantee for past specialist treatments to flooring undertaken recently should be obtained, checked and validated.

Drainage is to a shared septic tank located within the rear garden. It is assumed that the tank is registered with SEPA.

## Essential Repairs

None.

Estimated cost of essential repairs £  Retention recommended? ☐ Yes ☒ No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

## Valuations

Market value in present condition £ 270,000

Market value on completion of essential repairs £

Insurance reinstatement value £ 370,000  
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? ☐ Yes ☒ No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? ☐ Yes ☐ No

## Declaration

Signed	Security Print Code [531837 = 5662 ] Electronically signed by:-
Surveyor's name	Ewen S Sparks
Professional qualifications	BSc(Hons) MRICS
Company name	DM Hall LLP
Address	Shed 26, Unit 34, City Quay, Camperdown Street, Dundee, DD1 3JA
Telephone	01382 873100
Fax	01382 873109
Report date	22nd April 2022





# PROPERTY QUESTIONNAIRE



**DM HALL**  
CHARTERED SURVEYORS



# Property Questionnaire

<b>Property address</b>	BANKGATE COTTAGE, 2 BALMUIR, DUNDEE, DD3 0PA
<b>Seller(s)</b>	Ann Crozier
<b>Completion date of property questionnaire</b>	28/04/22

# Property Questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 22 years	
2.	Council tax	
	Which Council Tax band is your property in? (Please circle) Ⓐ B C D E F G H	
3.	Parking	
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <ul style="list-style-type: none"><li>• Garage <input type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input checked="" type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify): <input type="text"/></li></ul>	
4.	Conservation area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<del>Yes / No /</del> <del>Don't know</del>

# Property Questionnaire

5.	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<del>Yes</del> / No
6.	<b>Alterations/additions/extensions</b>	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p> <p>2 Bedrooms, stairs to the loft and an upper bathroom</p>	Yes / <del>No</del>
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	Yes / <del>No</del>
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes / <del>No</del>
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes</del> / No
	(ii) Did this work involve any changes to the window or door openings?	Yes / <del>No</del>
	<p>(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):</p> <p>windows were taken out and replaced with patio doors.</p> <p><b>Please give any guarantees which you received for this work to your solicitor or estate agent.</b></p>	

# Property Questionnaire

<b>7.</b>	<b>Central heating</b>	
<b>a.</b>	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered <u>yes / partial</u> - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). oil</p> <p>If you have answered <u>yes</u>, please answer the three questions below:</p>	<b>Yes / <del>No</del> / <del>Partial</del></b>
<b>b.</b>	When was your central heating system or partial central heating system installed?	2010
<b>c.</b>	<p>Do you have a maintenance contract for the central heating system?</p> <p>If you have answered <u>yes</u>, please give details of the company with which you have a maintenance contract:</p>	<b><del>Yes</del> / No</b>
<b>d.</b>	When was your maintenance agreement last renewed? (Please provide the month and year).	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<b><del>Yes</del> / No</b>
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered <u>yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<p><b><del>Yes</del> / No</b></p> <p><b><del>Yes</del> / No</b></p>
<b>b.</b>	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered <u>yes</u>, please give details:</p>	<b><del>Yes</del> / No</b>

# Property Questionnaire

<b>10.</b>	<b>Services</b>																									
<b>a.</b>	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas / liquid petroleum gas</td> <td>—</td> <td></td> </tr> <tr> <td>Water mains / private water supply</td> <td>✓</td> <td>mains with septic tank</td> </tr> <tr> <td>Electricity</td> <td>✓</td> <td>sse</td> </tr> <tr> <td>Mains drainage</td> <td>✓</td> <td>mains septic tank</td> </tr> <tr> <td>Telephone</td> <td>✓</td> <td>BT</td> </tr> <tr> <td>Cable TV / satellite</td> <td>—</td> <td></td> </tr> <tr> <td>Broadband</td> <td>✓</td> <td>BT</td> </tr> </tbody> </table>		Services	Connected	Supplier	Gas / liquid petroleum gas	—		Water mains / private water supply	✓	mains with septic tank	Electricity	✓	sse	Mains drainage	✓	mains septic tank	Telephone	✓	BT	Cable TV / satellite	—		Broadband	✓	BT
Services	Connected	Supplier																								
Gas / liquid petroleum gas	—																									
Water mains / private water supply	✓	mains with septic tank																								
Electricity	✓	sse																								
Mains drainage	✓	mains septic tank																								
Telephone	✓	BT																								
Cable TV / satellite	—																									
Broadband	✓	BT																								
<b>b.</b>	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes</u>, please answer the two questions below:</p>	<b>Yes / <del>No</del></b>																								
<b>c.</b>	(i) Do you have appropriate consents for the discharge from your septic tank?	<b>Yes / <del>No</del> / <del>Don't know</del></b>																								
<b>d.</b>	<p>(ii) Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p> <p>2 yearly contract with Scottish water</p>	<b>Yes / <del>No</del></b>																								

# Property Questionnaire

<b>11.</b>	<b>Responsibilities for Shared or Common Areas</b>	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No / <del>Don't Know</del>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No / <del>Not applicable</del>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<del>Yes</del> / No
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No
<b>12.</b>	<b>Charges associated with your property</b>	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	<del>Yes</del> / No



# Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p><del>Yes</del> / No / <del>Don't Know</del></p> <p><del>Yes</del> / <del>No</del> / <del>Don't Know</del></p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13. Specialist works		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p> <p>the floor in front bedroom was treated for damp</p>	<p>Yes / <del>No</del></p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p> <p>the floor boards were replaces and wood work treated</p>	<p>Yes / <del>No</del></p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p>Yes / <del>No</del></p>

# Property Questionnaire

<b>14.</b>	<b>Guarantees</b>						
<b>a.</b>	<b>Are there any guarantees or warranties for any of the following:</b>						
(i)	Electrical work	No	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<del>Cannot Answer*</del>
(ii)	Roofing	No	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<del>Cannot Answer*</del>
(iii)	Central heating	No	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<del>Cannot Answer*</del>
(iv)	NHBC	No	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<del>Cannot Answer*</del>
(v)	Damp course	<del>No</del>	Yes	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<del>Cannot Answer*</del>
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	<del>Yes</del>	<del>Don't know</del>	<del>With title deeds</del>	<del>Lost</del>	<del>Cannot Answer*</del>
<b>b.</b>	<b>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b> damp in front bedroom which was repaired						
<b>c.</b>	<b>Are there any outstanding claims under any of the guarantees listed above?</b> <b>If you have answered yes, please give details:</b>						<del>Yes</del> / No
<b>15.</b>	<b>Boundaries</b>						
	<b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b> <b>If you have answered yes, please give details:</b>						<del>Yes</del> / No / <del>Don't know</del>

# Property Questionnaire

<b>16.</b>	<b>Notices that affect your property</b>	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	<del>Yes</del> / No / <del>Don't know</del>
b.	that affects your property in some other way?	<del>Yes</del> / No / <del>Don't know</del>
c.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yes</del> / No / <del>Don't know</del>
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

**Declaration by the seller(s)/or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

**Signature(s):** \_\_\_\_\_  
 \_\_\_\_\_

**Date:** \_\_\_\_\_





# DM Hall Offices

Aberdeen

01224 594172

Galashiels

01896 752009

Livingston

01506 490404

Ayr

01292 286974

Glasgow (North)

0141 332 8615

Musselburgh

0131 665 6782

Cumbernauld

01236 618900

Glasgow (South)

0141 636 4141

Oban

01631 564225

Cupar

01334 844826

Hamilton

01698 284939

Paisley

0141 887 7700

Dumfries

01387 254318

Inverness

01463 241077

Perth

01738 562100

Dundee

01382 873100

Inverurie

01467 624393

Peterhead

01779 470220

Dunfermline

01383 621262

Irvine

01294 311070

Stirling

01786 475785

Edinburgh

0131 477 6000

Kirkcaldy

01592 598200

Elgin

01343 548501

Falkirk

01324 628321

[DMHALL.CO.UK](http://DMHALL.CO.UK)

