

HOME REPORT

66A CASTLE STREET
BROUGHTY FERRY
DUNDEE
DD5 2EJ



DM HALL
CHARTERED SURVEYORS

ENERGY PERFORMANCE CERTIFICATE



DM HALL
CHARTERED SURVEYORS

Energy Performance Certificate (EPC)

Scotland

Dwellings

66A CASTLE STREET, BROUGHTY FERRY, DUNDEE, DD5 2EJ

Dwelling type: Ground-floor flat
Date of assessment: 20 February 2025
Date of certificate: 21 February 2025
Total floor area: 81 m²
Primary Energy Indicator: 242 kWh/m²/year


Reference number: 7015-5522-2100-0110-1222
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,279	See your recommendations report for more information
Over 3 years you could save*	£1,155	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

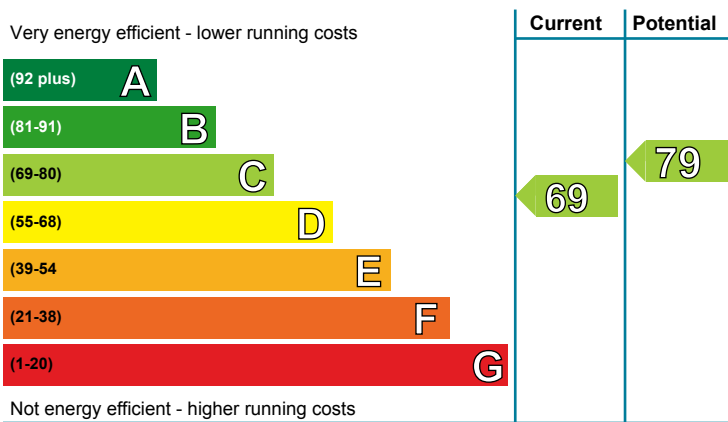


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (69)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

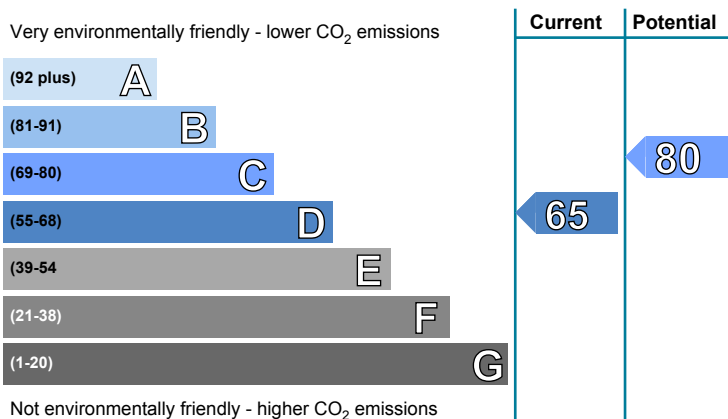

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (65)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£693.00
2 Floor insulation (suspended floor)	£800 - £1,200	£462.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, partial insulation (assumed)	★★★★☆☆	★★★★☆☆
Roof	(another dwelling above)	—	—
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆☆	★★★★☆☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 43 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.





Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,640 over 3 years	£1,485 over 3 years	
Hot water	£372 over 3 years	£372 over 3 years	
Lighting	£267 over 3 years	£267 over 3 years	
Totals	£3,279	£2,124	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£231		
2 Floor insulation (suspended floor)	£800 - £1,200	£154		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	10,733	N/A	N/A	(3,455)
Water heating (kWh per year)	1,937			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Mark Smith
Assessor membership number:	EES/009457
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	Shed 26, Unit 34 City Quay Camperdown Street Dundee DD1 3JA
Phone number:	01382873100
Email address:	Mark.Smith@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



DM HALL
CHARTERED SURVEYORS

Single Survey

survey report on:

Property address	66A CASTLE STREET, BROUGHTY FERRY, DUNDEE, DD5 2EJ
-------------------------	---

Customer	Mr Alan Phin & Mrs Gillian Phin
-----------------	---------------------------------

Customer address	
-------------------------	--

Prepared by	DM Hall LLP
--------------------	-------------

Date of inspection	20th February 2025
---------------------------	--------------------



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a ground floor flat, forming part of a two storey and attic mid terraced purpose built block of four flats.
Accommodation	GROUND FLOOR : Hall, lounge, main bedroom with en-suite shower room with WC, second bedroom, kitchen and bathroom with WC.
Gross internal floor area (m²)	81m
Neighbourhood and location	The subjects form part of a long established private residential development situated on the eastern periphery of Broughty Ferry Town Centre. The immediate surrounding properties are of similar age and construction. All essential amenities are available within easy reach.
Age	Built in 1876.
Weather	Dry, although dull/overcast. The report should be read in this context.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimney stacks are of stone construction, rendered externally. The flashing details are of cement.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Single Survey

Roofing including roof space	<p>The main roof is pitched and laid in slates, incorporating metal sheet ridging. There are also flat roofs laid in mineral felt, over the dormer window projections pertaining to the upper flatted dwellings.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater fittings are of cast iron.</p>
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are of solid stone construction, rendered externally and lined internally.</p>
Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are of uPVC framed double glazed styles, with those along the front elevation being of a sash and casement type.</p> <p>The entrance door to the subjects is of a plain/flush timber style.</p>
External decorations	<p>None.</p>
Conservatories / porches	<p>None.</p>
Communal areas	<p>Circulation areas visually inspected.</p> <p>The subjects are accessed via a communal stairwell.</p>
Garages and permanent outbuildings	<p>There is no garage. Street parking only.</p> <p>There are no outbuildings of significance pertaining to the subjects.</p>
Outside areas and boundaries	<p>Visually inspected.</p> <p>The subjects abut the public footpath at the front elevation. There is a shared garden to the rear, which is laid to lawn, incorporating a paving slab patio area and well stocked borders. The site boundaries are defined by timber fences and brick walls.</p>

Single Survey

Ceilings	<p>Visually inspected from floor level.</p> <p>The ceilings appear of timber lath and plaster, and plasterboard.</p>
Internal walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls appear to be of brick, plastered on the hard, and timber stud/plasterboard.</p>
Floors including sub floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors are of suspended timber construction. There is a small step down to the rear of the hall.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors are mainly of plain/flush timber styles, although the lounge and kitchen doors also incorporate glazing. The door facings and the skirting boards are of moulded timber styles.</p> <p>The kitchen fittings comprise floor standing and wall mounted units.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>Any original fireplaces have been removed and the openings blocked/sealed. At the time of inspection, there was an electric fire against the chimney breast within the lounge.</p>
Internal decorations	<p>Visually inspected.</p> <p>The ceilings are finished with paint. The walls are mainly finished with paint, although the kitchen is part clad with pointed brickwork, and the bathroom and shower room are tiled. The internal joinery is finished with preservative.</p>

Single Survey

Cellars	None.
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The consumer unit is located within a storage cupboard to the hall.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The meter is located within an external box against the rear elevation.</p>
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply. Pipework (where seen) is of copper and PVC. There is an enamel Belfast sink unit to the kitchen fittings.</p> <p>There is a white bathroom suite, comprising bath with overhead mixer shower unit and screen surround, wash hand basin and WC. There are also white fittings to the en suite, comprising enclosure with miser shower unit, wash hand basin and WC.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a gas fired central heating system, which also provides hot water. A combi boiler is wall mounted within the kitchen. The boiler serves wall mounted radiators. The programmer for the system is integral with the boiler.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is to the mains sewer.</p>

Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.
Any additional limits to inspection	For flats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.



Structural movement

Repair category	1
Notes	There was no obvious evidence of significant movement noted within the limitations of the inspection.



Dampness, rot and infestation

Repair category	1
Notes	There was no obvious evidence of significant dampness, rot or wood boring insect infestation. Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate, and moisture levels were found to be within an acceptable range.



Chimney stacks

Repair category	2
Notes	Some deterioration is evident to copings and sections of chimney head render are weathered. Ongoing maintenance and repairs should be anticipated. Ongoing maintenance and repairs should also be anticipated to the flashing details, to ensure they are watertight.



Roofing including roof space

Repair category	2
Notes	There are a number of chipped/damaged slates, and there are some corroded tie straps to the metal ridge. The roof coverings appear original and as result, ongoing maintenance and repairs should be anticipated. Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in on-going maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.



Roofing including roof space

Repair category	2
Notes	A roofing contractor will be able to advise further on the condition and life expectancy of the roof coverings, as well as on the costs for any repairs/replacement works.



Rainwater fittings

Repair category	2
Notes	Gutters are blocked in places and should be cleared. Some staining is also evident to render to the main walls, suggesting past leakage from parts of the rainwater fittings, and there is a corroded hopper to the front elevation. If left unattended, leakage from rainwater fittings can result in damp penetration.



Main walls

Repair category	2
Notes	Hairline cracking is evident to the external fabric, and there are also areas of bossed/hollow render. Some repairs should be anticipated.



Windows, external doors and joinery

Repair category	1
Notes	<p>The windows were generally found to be in a serviceable condition, although typical weathering/wear is now evident to some areas. A number of loose lever handles were also noted.</p> <p>The entrance door functioned satisfactorily.</p> <p>Windows and external doors can be problematic and over time their operation can be affected, and opening mechanisms damaged. It is therefore likely that attention will be required as part of an ongoing maintenance programme.</p>



External decorations

Repair category	-
Notes	Not applicable.

Single Survey



Conservatories/porches

Repair category	-
Notes	Not applicable.



Communal areas

Repair category	2
Notes	Typical decorative wear and tear is evident within the communal stairwell, and there are also areas of cracked, blemished and hollow plasterwork. These items are cosmetic in nature and should be capable of remedy during the course of decoration. The window frame to the rear is weathered and there is an area of broken glazing. Repairs should be anticipated.



Garages and permanent outbuildings

Repair category	-
Notes	Not applicable.



Outside areas and boundaries

Repair category	2
Notes	<p>The brick boundary walls are weathered/spalled in places. There are also some open mortar joints and there is an accumulation of vegetation at parts. Repairs should be anticipated.</p> <p>Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed by reference to the Title Deeds.</p>



Ceilings

Repair category	1
Notes	Within the limitations of our inspection, no reportable defects were evident.



Internal walls

Repair category	1
Notes	Within the limitations of our inspection, no reportable defects were evident.



Floors including sub-floors

Repair category	1
Notes	<p>The flooring was found to be generally level and firm to the tread.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> <p>No access to the sub-floor area was possible. Within the limitations of our inspection, there was no indication to suggest significant defects in this area, although it should be appreciated that as the area was not inspected, no guarantees can be provided in this regard.</p>



Internal joinery and kitchen fittings

Repair category	1
Notes	<p>The internal joinery has been replaced in the past. Within the limitations of our inspection, no reportable defects were evident.</p> <p>The kitchen fittings are along modern lines and generally appeared in a condition consistent with age and usage. Within the limitations of our inspection, no reportable defects were evident.</p>



Chimney breasts and fireplaces

Repair category	1
Notes	<p>The electric appliance was not tested. Some bossed/hollow plasterwork was noted to chimney breasts. This is cosmetic in nature, and should be capable of remedy during the course of routine decoration.</p>



Internal decorations

Repair category	1
Notes	<p>The subjects were found to be generally well presented throughout.</p>



Cellars

Repair category	-
Notes	<p>Not applicable.</p>



Electricity

Repair category	1
Notes	<p>Cabling (where seen) is of PVC and the consumer unit is of a circuit breaker type, albeit now along semi-modern lines. The last inspection of the system appears to have been carried out on 19th of January 2024. Certification should be confirmed.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p>



Gas

Repair category	1
Notes	<p>Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.</p>



Water, plumbing and bathroom fittings

Repair category	1
Notes	<p>Pipework (where seen) is of copper and PVC, and appeared in serviceable condition but was not tested.</p> <p>The sanitary fittings are along modern lines and generally appeared in a condition consistent with age and usage. Within the limitations of our inspection, no reportable defects were evident. Flooring beneath the shower tray was not inspected, however, it should be appreciated that over time the build-up of condensation together with small amounts of leakage from joints between tiling or mastic and shower fittings can lead to deterioration of flooring or wall linings. Repairs in this regard may be required as part of a normal and ongoing maintenance regime.</p>



Heating and hot water

Repair category	1
Notes	<p>It is assumed that the central heating system has been properly installed, updated, and maintained to meet with all current regulations and standards, with particular regard to flue and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation, further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system</p>

Single Survey



Drainage

Repair category	1
Notes	There was no surface evidence to suggest the drainage system is choked or leaking.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	1
External decorations	-
Conservatories/porches	-
Communal areas	2
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, interested parties make appropriate enquiries in order to satisfy themselves of the potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed. Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should also be confirmed by reference to the Title Deeds.

The subjects appear to have been formed from two smaller separate flats, with part now being located in the envelope of 66 Castle Street, and part being located in the envelope of 64 Castle Street. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £330,000 (THREE HUNDRED AND THIRTY THOUSAND POUNDS).

It should be noted that this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS). This figure bears no direct relationship to current market value.

Valuation and market comments

Having considered matters and taking into account of our general observations on site, we are of the opinion that the current market value of the subjects in their present condition, and with the benefit of full vacant possession may be fairly stated in the capital sum of £170,000 (ONE HUNDRED AND SEVENTY THOUSAND POUNDS).

Following buoyant market conditions over a prolonged period through the Covid 19 pandemic, there are now indications of a return to a more balanced level of supply and demand, partly influenced by current economic circumstances and changing interest rates.

Signed

Security Print Code [520769 = 5278]
Electronically signed

Single Survey

Report author	Mark Smith
Company name	DM Hall LLP
Address	Shed 26, Unit 34 City Quay, Camperdown Street, Dundee, DD1 3JA
Date of report	25th February 2025

Mortgage Valuation Report



Property Address

Address 66A CASTLE STREET, BROUGHTY FERRY, DUNDEE, DD5 2EJ
Seller's Name Mr Alan Phin & Mrs Gillian Phin
Date of Inspection 20th February 2025

Property Details

Property Type House Bungalow Chalet Purpose built maisonette
 Coach Studio Converted maisonette Purpose built flat
 Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

None.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame
 Solid Cavity Steel frame Concrete block Other (specify in General Remarks)

Roof Tile Slate Asphalt Felt
 Lead Zinc Artificial slate Flat glass fibre Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No
If Yes, is this recent or progressive? Yes No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No
If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating:

Gas fired boiler with radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Agricultural land included with property Ill-defined boundaries Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

The subjects form part of a well established private residential development situated on the eastern periphery of Broughty Ferry Town Centre. The immediate surrounding properties are of similar age and construction. All essential amenities are available within easy reach.

At the time of inspection, the subjects were found to be generally well presented throughout internally, with kitchen and sanitary fittings along modern lines. Any defects seen are considered to be capable of remedy during the course of routine maintenance and/or decoration. Externally, some works of repair and maintenance, typical of a property of this age and type were noted.

We have reflected the condition of the subjects in our valuation.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, interested parties make appropriate enquiries in order to satisfy themselves of the potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed. Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should also be confirmed by reference to the Title Deeds.

The subjects appear to have been formed from two smaller separate flats, with part now being located in the envelope of 66 Castle Street, and part being located in the envelope of 64 Castle Street. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

Essential Repairs

None.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property forms suitable security for loan purposes, subject to the specific lending criteria of the mortgage provider.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [520769 = 5278]
Electronically signed by:-

Surveyor's name Mark Smith

Professional qualifications BSc MRICS

Company name DM Hall LLP

Address Shed 26, Unit 34 City Quay, Camperdown Street, Dundee, DD1 3JA

Telephone 01382 873100

Fax

Report date 25th February 2025

PROPERTY QUESTIONNAIRE



DM HALL
CHARTERED SURVEYORS

Property Questionnaire

Property address	Flat, 66A CASTLE STREET, BROUGHTY FERRY, DUNDEE, DD5 2EJ
Seller(s)	Alan and Gillian Phin
Completion date of property questionnaire	25/02/2025

Property Questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property?	7 years
2.	Council tax	
	Which Council Tax band is your property in? (Please circle)	
	A	ⓑ C D E F G H
3.	Parking	
	What are the arrangements for parking at your property? (Please tick all that apply)	
	• Garage	<input type="checkbox"/>
	• Allocated parking space	<input type="checkbox"/>
	• Driveway	<input type="checkbox"/>
	• Shared parking	<input type="checkbox"/>
	• On street	<input checked="" type="checkbox"/>
	• Resident permit	<input type="checkbox"/>
	• Metered parking	<input type="checkbox"/>
	• Other (please specify):	<input type="text"/>
4.	Conservation area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes / No / Don't know

Property Questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No
6.	Alterations/additions/extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	Yes / No
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	Yes / No
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes / No
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes / No
	(ii) Did this work involve any changes to the window or door openings?	Yes / No
	<p>(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

Property Questionnaire

7. Central heating		
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered <u>yes / partial</u> - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>Gas central heating</p> <p>If you have answered <u>yes</u>, please answer the three questions below:</p>	Yes / No / Partial
b.	When was your central heating system or partial central heating system installed?	Don't know
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p>If you have answered <u>yes</u>, please give details of the company with which you have a maintenance contract:</p>	Yes / No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8. Energy Performance Certificate		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No
9. Issues that may have affected your property		
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered <u>yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<p>Yes / No</p> <p>Yes / No</p>
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered <u>yes</u>, please give details:</p>	Yes / No

Property Questionnaire

10. Services			
a.	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas / liquid petroleum gas	✓	Don't know - Tenant arranged all servic
	Water mains / private water supply	✓	Don't know
	Electricity	✓	Don't know
	Mains drainage	✓	Don't know
	Telephone	—	
	Cable TV / satellite	—	
	Broadband	✓	Don't know
b.	Is there a septic tank system at your property? If you have answered yes, please answer the two questions below:	Yes / No	
c.	(i) Do you have appropriate consents for the discharge from your septic tank?	Yes / No / Don't know	
d.	(ii) Do you have a maintenance contract for your septic tank? If you have answered yes, please give details of the company with which you have a maintenance contract:	Yes / No	

Property Questionnaire

11.	Responsibilities for Shared or Common Areas	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No / Don't Know
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p> <p>Shared between owners</p>	Yes / No / Not applicable
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	Yes / No
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> <p>Shared garden to rear</p>	Yes / No
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> <p>As above</p>	Yes / No
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	Yes / No
12.	Charges associated with your property	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	Yes / No

Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p>Yes / No / Don't Know</p> <p>Yes / No / Don't Know</p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<p>13. Specialist works</p>		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p>Yes / No</p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p>Yes / No</p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p>Yes / No</p>

Property Questionnaire

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):						
c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:					Yes / No	
15.	Boundaries						
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:					Yes / No / Don't know	

Property Questionnaire

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Don't know
b.	that affects your property in some other way?	Yes / No / Don't know
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Don't know
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): _____

Date: _____

ABERDEEN

aberdeen_residential@dmhall.co.uk
01224 594172

AYR

ayr@dmhall.co.uk
01292 286974

DUMFRIES

dumfries@dmhall.co.uk
01387 254318

DUNDEE

dundee@dmhall.co.uk
01382 873100

DUNFERMLINE

dunfermline@dmhall.co.uk
01383 621262

EDINBURGH

edinburghresidential@dmhall.co.uk
0131 624 6600

ELGIN

elgin@dmhall.co.uk
01343 548501

FALKIRK

falkirk@dmhall.co.uk
01324 628321

GALASHIELS

galashiels@dmhall.co.uk
01896 752009

GLASGOW (Residential)

glasgowresidential@dmhall.co.uk
0141 636 4141

HAMILTON

hamilton@dmhall.co.uk
01698 284939

INVERNESS

inverness@dmhall.co.uk
01463 241077

INVERURIE

inverurie@dmhall.co.uk
01467 624393

IRVINE

irvine@dmhall.co.uk
01294 311070

KIRKCALDY

kirkcaldy@dmhall.co.uk
01592 598200

LIVINGSTON

livingston@dmhall.co.uk
01506 490404

OBAN

oban-admin@dmhall.co.uk
01631 564225

PAISLEY

Enquiries are now dealt with at our Glasgow Hub.

PERTH

perth@dmhall.co.uk
01738 562100

PETERHEAD

peterhead@dmhall.co.uk
01779 470220

ST ANDREWS

standrews@dmhall.co.uk
01334 844826

STIRLING

stirling@dmhall.co.uk
01786 475785

